

TOSHIBA AMERICA INFORMATION SYSTEMS STORAGE DEVICE DIVISION IRVINE, CALIFORNIA

SD-R2212 CD-RW/DVD-ROM COMBINATION MOBILE DRIVE USER MANUAL

TOSHIBA

CONTENTS

Introduction1	Í
Setup	}
Using the CD-RW/DVD-ROM Combo Drive4	ŀ
Troubleshooting	5
Specifications	7
Drive Connectors10)



INTRODUCTION – SD-R2212

General Features

CD-R disc write at 8X, 12X & 16X Lead (Pb) Free Printed Circuit Board

3-way Disc Eject (eject button, software, emergency eject hole)

Average Access Time

CD	90ms
DVD-ROM	100ms
DVD-RAM	170ms

Horizontal or Vertical Mount

2MByte Buffer

Playback interchangeability for CD-ROM and DVD-ROM discs

Regionalization (RPC2 compliance) (DVD)

BUS Interface ATAPI

Types of Disc Formats Supported – Write:


- Applicable Write Format CD-R, CD-RW: Disc at once, Track at once, Session at once, Packet write
- Applicable Write disc CD-R, CD-RW: CD-DA, CD+(E)G, CD-MIDI, CD-ROM, CD-ROM XA, MIXED MODE CD, CD-I, CD-I Bridge (Photo-CD, Video-CD), Multisession CD (Photo-CD, CD-EXTRA, Portfolio)

Types of Disc Formats Supported – Read:

- DVD: DVD-ROM (DVD-5, DVD-9, DVD-10, DVD-18), DVD-R (ver 1.0 & 2.0, read), DVD-RW (ver 1.1, read), DVD-RAM (ver 2.1 & 1.0, read)
- CD: CD-DA, CD+(E)G, CD-MIDI, CD-TEXT, CD-ROM, CD-ROM XA, MIXED MODE CD, CD-I, CD-I Bridge (Photo-CD, Video-CD), Multi-session (Photo-CD Disc, CD-Extra, Portfolio, CD-R, CD-RW), CD-R (read), CD-RW (read)

Front Panel

Figure 1.SD-R2212 CD-RW/DVD Combo Drive Front Panel

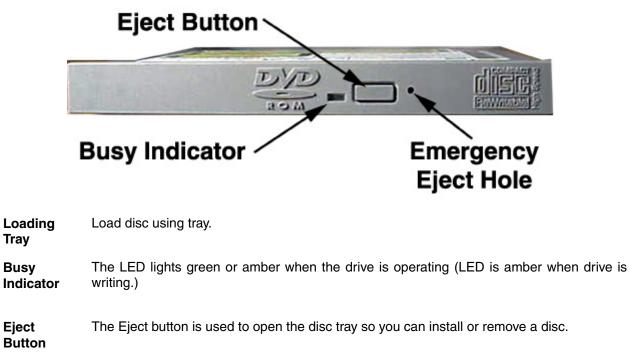

Emergency The emergency eject hole is to be used only when the Loading Tray will not open when Eject button is pressed.

TOSHIBA

SETUP – SD-R2212

Toshiba recommends that only trained professionals install this CD-RW/DVD-ROM Combo drive into your laptop/notebook.

Installation Notes

- The SD-R2212 CD-RW/DVD-ROM Combo drive has no jumpers that need to be set
- Mounting orientation: 15° (horizontally), 15° vertically (volume control in down position), 30° (drive with volume control in up position).
- When mounting drive use 4 M2-PO.4 tapping holes located on the left and right sides of drive.
- When mounting drive, the tightening torque of the four screws must be even. Recommended screw tightening torque is 2N
- For clearance around the front bezel, it is recommended that a clearance of more than 0.8mm should be left in all directions.

Software Driver

Toshiba's SD-R2212 drive does not require any unique device drivers for Windows '98/2000/XP/NT. After installing your drive and re-booting, your system should recognize your drive. Win '98/2000/XP/NT Operating Systems support all Toshiba's ATAPI drives natively. If you prefer using DOS, download the ATAPI driver from our web site.



USING THE CD-RW/DVD-ROM Combo Drive – SD-R2212

Drive Operation

Inserting Media

To insert media perform the following steps:

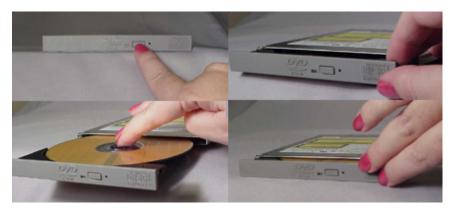


Figure 1.Inserting Disc

- 1. Open the drive's loading tray by pressing the Eject Button and pulling out the tray.
- 2. Place media disc into drive's loading tray, and lightly press down on the inner portion of the disc.
- 3. Gently close the disc tray.

Removing Media

To remove media disc from the drive, perform the following steps:

- 1. Open the loading tray by pressing the Eject Button, and pulling tray out.
- 2. Grasp disc by it's outer edge, and lift out of loading tray.
- 3. Gently close the loading tray.

Usage Guidelines

- Keep the disc tray closed when not using the CD-RW/DVD-ROM Combo drive
- Do not press down on the disc tray when opening or closing it.
- Do not place objects on the disc tray
- Never use a damaged, broken, or deformed disc
- Do not press the Eject button while the drive is playing a DVD movie or accessing a disc. To stop a DVD movie, click Stop button in the DVD player application program



NOTE: High-speed drives spin the disc at a high rotational speed. If a disc has printing on only half of the disc, or if there is a slight imbalance in the disc, the imbalance is greatly magnified by the high speed, causing the drive to vibrate or produce a fan-like noise. These effects are inherent in the highspeed technology and do not indicate a problem with the drive.

Regional Coding

Region Protection Coding (RPC) of DVD Discs: this feature is supported on DVD Players and is used with DVD-Video Discs (i.e. movies). Currently, the motion picture industry has divided the world into different regional "zones." These regions or "zones" correlate to the regional markets into which the motion picture industry releases movies. Simply put, RPC Codes are placed on Movie Discs marketed throughout the world based on the region of the world where they are being sold. These RPC codes help to control and prevent the pirating of new release movies into other motion picture market regions prior to their true release dates within those markets.

The SD-R2212 DVD-ROM/CD-RW drive supports the current RPC phase 2 industry specifications. This means that when the DVD-ROM drive ships from the factory it is set to the region for which the Operating System was intended. In other words the drive is set to support the Region 1 (North America) Operating System and will only play Region 1 (North America) DVD-Video movie discs.

Emergency Ejection



CAUTION: The following procedure is intended only as a last resort when pressing the eject button fails to open the Loading Tray.

- 1. Turn computer power OFF by properly shutting down system.
- 2. Insert a solid bar (i.e. large paper clip) into Emergency Eject hole and push in as shown in the picture below.
- 3. Loading tray will open/eject.

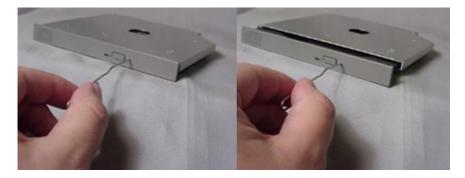


Figure 2.Using Emergency Eject

Handling Media

DVD media is sensitive to dust and fingerprints. Carefully handle media by its edges only. If a DVD movie skips or hangs during playback, clean the media. Most DVD video playback issues are media-related and can be remedied by proper handling and care of media.

Cleaning Media

Try to avoid touching the read area (underside) of the disc as dirt and smears will degrade the disc accessing speed.

If the disc becomes dirty wipe it with a damp soft cloth. Avoid cleaning in a circular motion, but rather from the inner side outward.



TROUBLESHOOTING – SD-R2212

Problem	Solution
Disc tray cannot be opened	 Check that there is power to drive. Use Emergency Eject instructions to open tray.
Drive is not recognized by system	 Is the drive connected properly? Are all cables plugged in properly (e.g. Power Cable, Interface Cable and Audio Cables). Is the software driver loaded? On a step-by-step (F8) Boot of the system is the CD-RW/DVD-ROM Combo drive recognized? (BIOS / DOS reports "device driver not found" or "no valid drivers selected."). If not, Contact Technical Support. Has the CD-RW/DVD-ROM Combo drive software driver been corrupted by a virus. Run a Virus Scan program and repair if possible. Contact Technical Support if the Virus renders the CD-RW/DVD-ROM Combo drive software the CD-RW/DVD-ROM Combo drive software driver been corrupted by a virus. Run a Virus Scan program and repair if possible. Contact Technical Support if the Virus renders the CD-RW/DVD-ROM Combo drive software drivers not useable.
Drive is not recognized by system during Boot process, but is recognized by the Operating System (i.e. XP, Win2000, Win98, Win NT, etc.)	 Is the CD-RW/DVD-ROM Combo drive software driver loaded? On a step-by-step (F8) Boot of the system is the CD-RW/DVD-ROM Combo drive recognized? (BIOS / DOS reports "device driver not found" or "no valid DVD drivers selected."). If not, Contact Technical Support. Has the Windows CD-RW/DVD-ROM Combo drive software driver program been corrupted by a virus. Run a Virus Scan program and repair if possible. Contact Technical Support if the Virus renders the software drivers not useable.
BUSY Indicator LED flashes slowly	 The disc may be dirty Clean it with a soft damp cloth. Avoid cleaning the disc using a circular motion. The disc should be wiped in a radial direction. That is, from the inner side outward. The laser lens may have become cloudy or blocked by particulate matter. Please contact Technical Support.
BUSY Indicator LED is constantly ON	Possible Hardware Problem. Please contact Technical Support.
DVD-ROM can not play a DVD in the drive or certain types of CD media (i.e. CD-plus, etc.)	 Is the CD-RW/DVD-ROM Combo drive driver loaded Is the DVD disc the correct format for the type of system that you are using? (i.e. on a PC an ISO9660 IBM compatible PC format as opposed to Apple/Mac HFS disc or UNIX disc formats which will not function). Do you have the correct software applications program/drivers installed to run a DVD disc? Has the Windows CD-RW/DVD-ROM Combo drive software driver program been corrupted by a virus. Run a Virus Scan program and repair if possible. Contact Technical Support if the Virus renders the software drivers not useable.



SPECIFICATIONS – SD-R2212

General

Interface: ATAPI

Compatible CD-RW/DVD-ROM Standard - Write:

Write Formats: Disc at once, Track at once, session at once, Packet Write CD-R, CD-RW:

Write Disc:	CD-DA, CD+(E)G, CD-MIDI, CD-TEXT, CD-ROM, CD-ROM XA,
CD-R, CD-RW:	MIXED MODE CD, CD-I, CD-I BRIDGE (Photo-CD, Video-CD), Multi-
	session CD (Photo-CD, CD-Extra, Portfolio)

Compatible DVD-ROM Standard - Read:

DVD:	DVD-ROM (DVD-5, DVD-9, DVD-10, DVD-18)
	DVD-R (ver 1.0 & 2.0, read)
	DVD-RW (ver 1.1, read)
	DVD-RAM (ver 2.1, read)
CD-ROM:	CD-DA, CD+(E)G, CD-MIDI, CD-TEXT, CD-ROM, CD-ROM XA, MIXED MODE CD, CD-I, CD-I Bridge (Photo-CD, Video-CD), Multi-session (Photo CD Disc, CD-Extra, CD-R, CD-RW), CD-RW (read), CD-R (read)

Note: All DVD/CD formats, except CD-Red Book (audio), require additional application specific software and/or hardware. The drive is capable of reading these data formats. However, in order to run applications that use these formats, you must first have the required software and/or hardware.

4.377GB (DVD-5)
7.959GB (DVD-9)
8.754GB (DVD-10)
15.917GB (DVD-18)
3.679GB
4.377GB
4.377GB
2,324GB
656.5MB (mode 1)
748.8MB (mode 2)

Performance

Rotational Speed

DVD (Single)
DVD (Dual)
DVD-R, DVD-RW
DVD-RAM (ver 2.1)
DVD-RAM (ver 2.1)
CD-ROM, CD-R
CD-DA Transfer
Video-CD, CD-DA
CD-RW (read) - normal
CD-RW (read) - high speed
CD-R (write)
CD-RW (write)
CD-RW (write) - high speed

Transfer Rate

DVD (Single)	4,463 - 10,820KB/second
DVD (Dual)	3,380 – 4,056KB/second
DVD-RAM (Ver 2.1)	2,740KB/second
DVD-RAM (Ver 1.0)	2,740KB/second
CD-ROM (mode 1)	1,552 - 3,600KB/second
CD-ROM (mode 2)	1,761 - 4,104KB/second (mode 2)

Random Access Time

DVD CD **DVD-RAM**

Data Error Rate

DVD-ROM CD-ROM

Data Buffer

Reliability

MTBF Power ON Hours **ON/OFF** Cycles Number of Access **Operating Duty Cycle**

MTTR

4,670rpm (3.3 - 8X) 3,792rpm (2.5 - 6X) 2,240rpm (1.7 - 4X) 1,400 - 3,300rpm (1X) 2,200 - 4,800rpm (2X) 5,100rpm (10.3 - 24X) 2,350 – 4,300rpm (8.6 – 12x) 1,200 - 2,000rpm (4 - 6X) 1,200 - 2,000rpm (4 - 6X) 2,560 - 4,000rpm (8 - 12X) 3,200 - 5,000rpm (8 - 24X) 850 - 1,980rpm (4X) 3,125 - 4,950rpm (10X)

100ms 90ms 170ms

10⁻¹⁵ Max 10⁻¹⁵ Max (Mode 1) 10^{-12} Max (Mode 2)

2MB

60,000 hours 5,436 hours/year 313 cycles/year 600,000 accesses/year 20% of Power ON time (Reading/Seeking) 2% of Power ON time (Writing/Seeking) 0.5 hours

Environmental

Ambient Temperature Operating Storage Shipping Temperature Gradient Operating Storage/Shipping	5° to 50° C (41° to 122° F) -10° to 60° C (14° to 140° F) -40° to 65° C (-40° to 149° F) 11° C /hour (max) 20° C /hour (max)		
Relative Humidity Operating Storage/Shipping	8% to 80% 5% to 95% (wet bulb 40° C max)		
Vibration Operating (5 to 500 Hz) (read) Operating (5 to 500Hz) (write) Non-operating (10 to 500Hz) Transporting (with packing) (10 to 25 Hz)	2.45 m/s ² (0.25G) (O-P) 2.45 m/s ² (0.25G) (O-P) 9.8 m/s ² (1.0G) (O-P) 9.8 m/s ² (1.0G) (O-P)		
Shock (Non-operating)	490 m/s² [50G]		
Acoustical Noise	40dB		
Power			
DC Voltage and Current Requirements	+5V ±5% (Operating) +5V ±8% (startup)		
Physical			
Height Width Depth Weight	0.5" (12.7mm) 5.04" (128mm) 4.96" (126.1mm) 7.0oz (2kg)		

Connectors

IDE Interface Connector

50 Pin I/F ATAPI Standard

Regulatory

The SD-R2212 DVD Writeable drive has been certified by the following regulatory agencies:

- UL 1950
- CSA C22.2 No. 950
- TUV (EN60950I)
- CE standard
- DHHS 21 CFR Sub-Chapter J
- FDA CFR21, EN60825



Drive Connectors – SD-R2212



Figure 1.SD-R2212 DVD Writeable Drive Rear Panel – Connector

ATAPI A 50-pin ATAPI interface connector is found at the rear of the SD-R2212 CD-RW/DVD-ROM Combo drive. Connecting cable should use Japan Aviation Electronics Industry Limited KX14-50Series L or equivalent connector.

Table 1.Interface Pin Assignments

PIN NO.	I/O	SIGNAL NAME	PIN NO.	I/O	SIGNAL NAME
1	0	Audio L-CH	2	0	Audio R-CH
3		Audio Ground	4		Digital Ground
5	I	/RESET	6	I/O	DD8
7	I/O	DD7	8	I/O	DD9
9	I/O	DD6	10	I/O	DD10
11	I/O	DD5	12	I/O	DD11
13	I/O	DD4	14	I/O	DD12
15	I/O	DD3	16	I/O	DD13
17	I/O	DD2	18	I/O	DD14
19	I/O	DD1	20	I/O	DD15
21	I/O	DD0	22	0	DMARQ
23		Ground	24	I	/DIOR: / HDMARDT: HSTROBE
25	I	/DIOW:STOP	26		Ground
27	0	IORDY: / DDMARDY: DSTROBE	28	I	/DMACK
29	0	INTRQ	30	0	/IOCS16
31	I	DA1	32	I/O	/PDIAG
33	I	DA0	34	I	DA2
35	I	/CS1FX	36	Ι	/CS3FX
37	I/O	/DASP	38	Ι	+5V (Motor)
39	I	+5V (Motor)	40	I	+5V (Motor)
41	I	+5V (Logic)	42	Ι	+5V (Logic)
43		Ground	44		Ground
45		Ground	46		Ground
47	I	CSEL	48		Ground
49	I	Vendor Unique*	50	I	Vendor Unique*
*Vender Unique, don't connect pins					